



## Technical Service Bulletin


### SSF-300 Speedy Super Foamer

Re: Failure of unit to dispense detergent from bottle.  
Water being released from the air mixture vent holes.

If your Speedy Super Foamer is experiencing either of these two issues, perform the following troubleshooting procedure.

1. Disconnect the Speedy Super Foamer from the high pressure water hose.
2. Remove the dispenser bottle.
3. Remove the quick connect fitting from the rear of the Speedy Super Foamer.
4. Using a properly sized flat screwdriver, tighten the water jet installed under the quick connect fitting.
5. Reinstall the quick connect fitting with white thread tape, tighten securely to ensure proper seal.
6. Re-install bottle (and pickup tube if removed).
7. Test unit for proper operation.


Remove Bottle



Remove Fitting



Tighten Jet

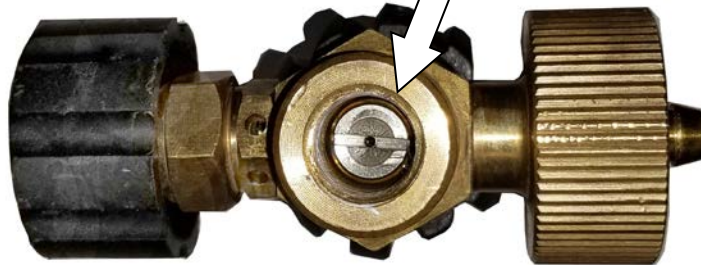

Apply Thread Tape

